


## VIEW FROM SPIGOT SIDE

# **SECTION A-A**


### VIEW FROM SOCKET SIDE

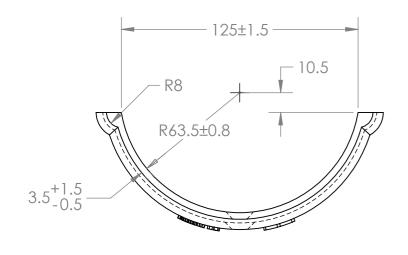

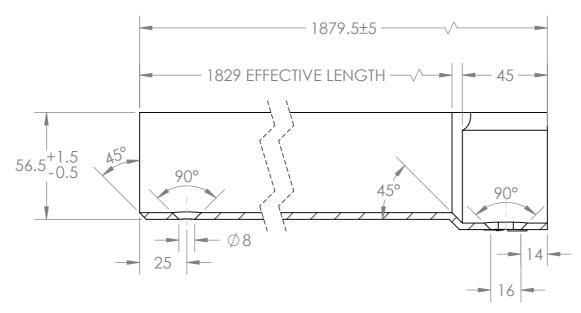

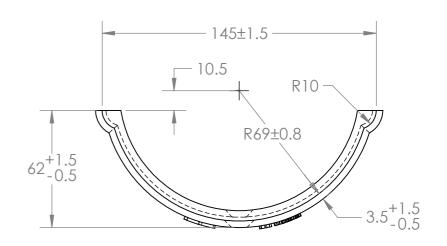


- 1) GUTTER TO BE STRAIGHT MAX PERMITTED BOW 2.5mm/metre.
- 2) EXCESSIVE UNDULATION NOT ACCEPTABLE ON GUTTER EDGES.
- 3) COLD LAPS OR THROUGH HOLES NOT PERMITTED.
- 4) GUTTER SURFACE TO BE CLEAN AND FREE OF CONTAMINENTS OR RUST PRIOR TO PAINTING.
- 5) IT IS ESSENTIAL THAT THE SOCKET AND SPIGOT ENDS FOR BOTH GUTTERS AND FITTINGS ARE CHECKED FOR COMPATIBILITY THROUGH A RECORDED QUALITY SYSTEM BEFORE LEAVING THE MANUFACTURER.



IMPORTANT: THE ANNULI (A) 2.0 MIN. BETWEEN SOCKET AND SPIGOT JOINT IS CRITICAL FOR THE PERFORMANCE OF THE JOINT.

# VIEW FROM UNDERSIDE

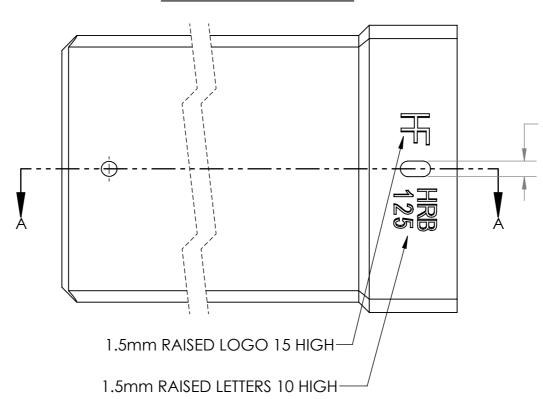

ALL MARKINGS TO BE 8MM MIN CLEAR OF SLOT TO ALLOW ROOM FOR FIXINGS

#### ALL DIMS IN mm

WATER LANE SOUTH PARADE HALIFAX WEST YORKSHIRE HX3 9HG

Hargreaves Foundry Group

1561 Grade:EN-GJL-150 Clarke P Gill АЗ 07/06/24

HB5001

25mm Beaded HR Gutter 6ft

TEL: (44) 01422 330607 FAX: (44) 01422 320349

-MAIL info@hargreavesfoundry.co.uk

# UNCONTROLLED

#### Copyright and Design right

This confidential drawing is the sole property of Hargreaves Foundry Group Companies and must not be reproduced or distributed to any third party withoutwritten permission. It must only be used for the purpose for which it has been issued and may be withdrawn upon request. The validity of the drawing is only guaranteed at the time of issue and is subject to change without notice.